Inveo Sp. z o.o.

BoxID/Clocker/Daxi/IQIO/IND2/RCP2

Instruction Manual

Firmware update

Information

The module is equipped with the possibility of firmware updates. Firmware is delivered in form of a .bin file

Warning

Incorrect use of the firmware update function may result in module damage.

To conduct the firmware update, select the update file using the built-in www server. In order to do that, go to the **Administration** tab, then select **Update** and **Browse**.

After uploading the file, all you need to do is to press **Update Firmware**.

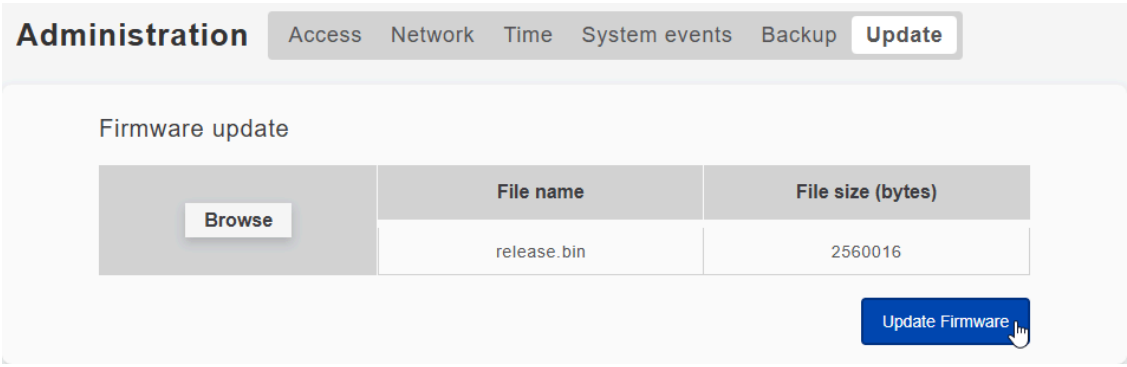

Information

Programming takes about 2 minutes. A message confirms that the process is completed.
It is recommended to revert the device to factory settings after a firmware update.